



Verizon

Wholesale Services
Mail Code HQE02M51
600 Hidden Ridge
Irving, TX 75038-3897

August 30, 2002

IMPORTANT INFORMATION

It has recently come to our attention that numerous 1+ calls are being sent to our Florida Access Tandems, TAMPFLXA01T, TAMPFLX02T and TAMPFLXA03T, with the incorrect OZZ Codes/Circuit Digits.

This is a reminder that the correct OZZ codes/Circuit Digits for those tandems are as follows:

Line Type	1+	0+	00-	011+	01+	800	900	CT	950
MF-NCN	060	061	061	138	158	060	060	062	na
MF-HTM	060	061	061	138	158	060	060	062	na
MF-CN	na	063	063	na	158	060	na	062	na
MF-CSD	056	na	na	156	157	na	na	na	na
SS7-NCN	08	09	09	01	02	08	08	10	na
SS7-CN	na	11	11	na	02	08	na	10	na

It is especially critical to send the correct OZZ Codes/Circuit Digits to the Access Tandems when any Interexchange Carrier segregates traffic on separate trunk groups. Failure to do so may result in calls being blocked by the Interexchange Carrier to which the call is directed.

On September 6, 2002 Verizon is adding an Operator Trunk Group to each of the Florida Access Tandems for an Interexchange Carrier at that carrier's request. This may result in blocked calls if the incorrect OZZ Codes/Circuit Digits are sent.

Please review your existing switch translations immediately to make sure they comply with the table above.

If there are any questions, please contact your Account Manager.

To add your name to the electronic distribution of these notices, send e-mail to beth.mullens@verizon.com.